

TL-ULTRALIGHT s.r.o. NOTICE OF CORRECTIVE ACTION

NOTIFICATION

Air Filters

ISSUED BY:

TL-Ultralight s.r.o.
Budova č.84 Letiště, 503 41 Hradec Králové
Czech Republic
Tel: +420 495 211 753
URL: <http://www.tl-ultralight.cz/>

DATE OF NOTICE: January 21, 2007
EFFECTIVE DATE: Immediately
LIMITATIONS: None
AFFECTED AIRCRAFT: TL-Ultralight StingSport
AFFECTED SERIAL NUMBERS: All serial numbers
NOTICE ID: 012107
THIS NOTICE SUPERCEDES: NA
PAGES: This is page 1 of 1 pages.

REFERENCES: Rotax Service Instruction #SI-912-017

DISCUSSION:

Asymmetric air filters like part no. 825711 can not be installed in the StingSport as described in Rotax Service Instruction #SI-912-017. Instead, asymmetric air filters, if installed by the aircraft manufacturer, are in position #3, as shown in figure #3 on page #5 of the referenced Service Instruction.

CORRECTIVE ACTION:

At the next regular inspection, confirm that asymmetric air filters are installed in position #3, as shown in figure #3 on page #5 of the referenced Rotax Service Instruction. Secure with stainless steel safety wire in two locations more than 90 degrees apart along the filter perimeter. Document this action in the aircraft maintenance log.